

## **Sport Aviation Corp Ltd**

## Microlight Aircraft Defect Report

Reporter's Name:						
Address: Rear seat control stick restricted in movement						
Al-		Г		- DW To	-F-/E-	
Aircraft Registration:	will remain confidential					
Microlight Type: @UADCiTY Model: CHALLEN SIZ: 3 TT						
Total Time in Service: - Airframe: 428 Hours Engine: SAME. Hours						
Hours Since last Inspection: NILL 6 MINTH'S Report date: 20111117						
Reporter:	Owner	Inspector	Safety Officer	Other	~	
Defect Type:	Airframe	Engine	Instruments	Other	) -	Circle
Location if Airframe:	Fuselage	Wings	Tail	Other		
Discovered During:	Preflight	Inspection	Maintenance	Flight		Other
Describe the defect in detail (attach photos if possible): Dignic MAINTENANCE CHECKS.						
FOUND RUBNIARKS ON REAR SURFACE OF FRONT SEAT FURTHER						
CHECKS CONFIRMED WHEN FRONT CENTROL STEK IS PLISHED FORWARD						
AS IN NOSEDOWN DESCENT, THE REARCONTROLL STICK IS						
ABLE TO RECOME RESTRICTED IN SIDEWAYS MODEMENT BY THE						
Describe the effects (if any) of the defect on airworthiness: FROAT SEAT - BACK SUPPERTS.						
AND ALSO RESTRICT AMOUNT OF FORWARD STICK.						
REAR CONTROL STICK IS THE MASTER AND FRONT STICK IS						
SLAUE SO RENO VAL Dould require all new cables.						
Describe remedial action taken and by whom:   CUT MINE OFF AT THE FACOR						
WENT THE USED FIR TRAINING. ITAL ITAL STRIP RIVETTED						
BETWEEN SAT UPRIGHTS WOULD KEEP REAR STICK FREE RUT WOULD						
TRADELME ARE SHOWING SAME RUB MARKS ON REGROFFRONT SEAT.						
Sport Aviation Corp. Ltd Operations Manual Revision 0 01 Apr 2011 Form # 8.9						